

Understanding specifications for precision multimeters

Application Note

Digital multimeters are the workhorses of the electronics industry. Almost all of the electronic products we use in our personal and professional lives are built or serviced using multimeters.

 
Different DMM applications require different degrees of attention to specs. A technician checking a logic power supply can use his trusty bench DMM confidently to verify that the supply is within a few percent of 5 V. However, when the job requires testing critical circuits, checking precision components, making fine adjustments in production, verifying compliance with industry standards, or taking measurements outside the controlled environment of the lab, then you'll need to evaluate specifications carefully.

A solid understanding of specifications is critical when you're evaluating the suitability of DMMs for an application, or when you must be confident that your readings accurately reflect reality. This application note discusses some of the thinking behind DMM specifications and spec sheets. It defines the various elements of DMM specs and gives tips on how to apply them.

Specifications and the spec sheet

Whenever we take a measurement with any meter, we're gambling. We're gambling that the instrument is going to give us the "real" reading. Fortunately, it's a very safe bet that a quality multimeter will deliver readings that coincide with reality. Specifications quantify the confidence of getting accurate readings and the risk of seeing inaccurate readings.

A specifications document is a clearly written description of an instrument's performance. It should quantify an instrument's capabilities objectively under well-defined operating



- Completeness any factor that impacts uncertainty is covered, including operating limits such as humidity, altitude, or vibration
- Clarity all efforts should be made to make the specifications straightforward
- Objectivity does not attempt to mislead for the sake of promotion

A well-written specification should maintain the same level of integrity as a medical chart or bank statement. Manufacturers must stand firmly behind their specs and you should fully expect that the information you are getting is accurate and complete.

On the spec sheet, you should see measurement uncertainty specs and modifiers that affect the uncertainty. You will also see operating limits that constrain the environment in which the uncertainty specifications will hold true. These are stated in numerical values (e.g. humidity) or with reference to international standards (shock and vibration). First let's take a closer look at how we quantify measurement uncertainty.

Where do uncertainty specifications come from?

The main job of a DMM specification is to establish the measurement uncertainty for any input in the instrument's range. The spec answers the question, "How close is the value on the meter display likely to be to the actual input to the meter?"



Meter manufacturers bet their reputations on how a large population of instruments is going to behave for the duration of calibration cycle. (A typical calibration cycle is one year.) Instrument engineers and metrologists use laboratory testing and carefully applied statistics to set the specs.

DMM specifications apply to a particular model (i.e. design), not to any individual instrument. Any single instrument of a particular design should perform well within the specification, especially toward the beginning of its calibration cycle. A model's specs are based on testing a significant sample of products and analyzing the collected data from the instruments.

If we take measurements of a nominal input from, say, 50 instruments of the same design, we are going to get a range of readings. Many of the instruments will have the same readings, but we would expect some variation due to normal uncertainty. For example, we can record the readings from 50 Fluke Model xyz DMM's hooked up to the same precision calibrator outputting 10 volts. We will record a narrow spread of readings around 10 volts. We can calculate the mean (average) of all the measurements, which we would expect to be 10 V. We can also calculate the standard deviation of the readings (Equation 1).

$$\sigma = \sqrt{\frac{\sum_{i=1}^{N} (x_i - \overline{x})^2}{N-1}}$$

Equation 1. N = sample sizeX = measurement

The standard deviation is a measure of the "spread" of the sample of measurements, outward from the mean. This measure of spread is the basis of uncertainty specifications.

If we plot the number of times each reading occurs, we should see a bell-shaped normal distribution. (Almost all measurements follow a normal distribution, including those made with simple instruments like rulers and measuring cups.) Figure 1 shows a

normal distribution curve centered at 10 V.

Using experimentation and experience, instrument designers set specifications by assuming a normal distribution and finding the standard deviation for a significant number of design samples. Adopting a normal distribution allows us to relate standard deviation to the percentage of readings that occur, by measuring the area under the curve.

68 % of the readings will be within 1 standard deviation of the mean

95 % of the readings will fall within 2 standard deviations of the mean

99.7~% of the readings will fall within 3 standard deviations of the mean

Statisticians refer to these percentages as confidence intervals. They might say, "We are 95 % confident that a reading will not be more than 2 standard deviations of the actual value."

In the simple example above

1 standard deviation corresponds to $\pm~0.02~\text{V}$

2 standard deviations corresponds to $\pm~0.04~\text{V}$

3 standard deviations corresponds to $\pm~0.06~\textrm{V}$

So the guestions for the manufacturer become, "How many standard deviations do we use for our spec?" "What confidence interval do we use to build our specs?" The higher the number of standard deviations, the lower the probability that an instrument will fall out of spec between calibrations. The manufacturer's internal engineering standards will determine how many standard deviations are used to set the spec. Fluke uses a confidence of 99 %, which corresponds to 2.6 standard deviations on a normal distribution.

Traceability and specifications

So far we have described how much uncertainty we can expect from a DMM, but we have not

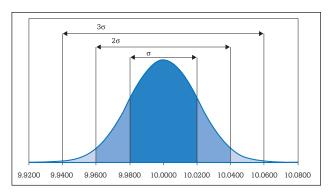


Figure 1: A normal distribution with a mean of 10 volts and standard deviation 0.02 volts.

discussed how we make sure we're all talking about the same volt, ohm or amp. DMMs must trace their measurement performance back to national laboratory standards.

DMMs are usually calibrated using multifunction calibrators like the Fluke 5700A or Fluke 9100. But there are usually a number of links between the DMM and national standards. including calibrators and transfer standards. As you move through the chain between your DMM and the national standards lab. the calibration standards become increasingly accurate. Each calibration standard must be traceable to national standards through an through an unbroken chain of comparisons, all having stated uncertainties.

So the uncertainty of a DMM depends on the uncertainty of the calibrator used to calibrate it. Most DMM specs are written assuming two things:

- The DMM has been calibrated using a particular model of calibrator, usually specified in the DMM service manual.
- The calibrator was within its operating limits and traceable to national standards.

This allows a DMM manufacturer to include the uncertainty of the calibrator in the DMM uncertainty specs. If you see an uncertainty listed as "relative" this means the uncertainty in the calibrator output has not been considered and it must be added to the DMM uncertainty.



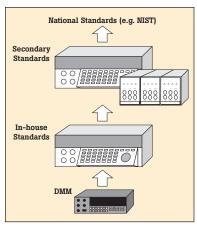


Figure 2: Traceability is the path from your DMM back to national standards.

Elements of digital multimeter specifications

Among the many standards that govern instrumentation, there is no standard for writing DMM specs. Over the years, though, manufacturers have converged on similar formats, making it a bit easier to compare multimeters. This application note covers the most common conventions for specifications.

As described above, uncertainty specifications define a range around a nominal value. When taking a measurement within the specified limits of time, temperature, humidity, etc., you can be confident that you won't get a reading outside that range.

Time and temperature are crucial for determining uncertainty. Electronic components experience small changes (or "drift") over time. Because of drift, DMM uncertainties are valid only for a specified period of time. This period usually coincides with the recommended calibration cycle and is typically one year. At calibration, the clock starts over again and the uncertainties are valid for another period.

Temperature affects the performance of every component in an instrument—from the simplest resistor to the most elegant integrated circuit. DMM designers are good at building circuits that compensate for temperature variation. This ability to operate at various temperatures is captured in a specified operating range and is often accompanied by a temperature coefficient. (More on this later.)

Multimeter uncertainties cannot be given as simple percentages, although it is tempting to over simplify. You might see a sales brochure that touts, "Basic accuracy to 0.002 %". This is only giving a small part of the picture, and it's usually an optimistic view of the data.

The reasons for complexity in the specifications have to do with the multimeter's ability to perform many different measurements, over many different ranges, using several different internal signal paths.

Consider the diagram in Figure 3. It shows the analog signal path for a dc voltage measurement, also known as "the front end". Each block contributes uncertainty in the form of nonlinearity, offset, noise and thermal effects. The front end contributes most of the uncertainty of the instrument.

Depending on the design, changing ranges affects the divider performance or the amplifier performance or both. Internal noise, for example, has a greater relative impact on lower ranges and at the low ends of ranges. Changing functions alters the signal path. For example, a resistance measurement requires the addition of a current source to the analog path. So each function and range must be specified in a way that considers the effects of non-linearities, offsets, noise and

thermal effects. Table 1 shows the elements of a DMM specification and gives examples for each.

 


Figure 3: Simplified DMM analog signal path for dc volts measurement.

	Example
Baseline uncertainty	
Input	± (0.001 % of reading + 3 digits)
Scale term + floor	± (0.001 % of reading + 3 digits)
Uncertainty modifiers	
Temperature coefficient	\pm (0.003 % of reading) per °C from 0 °C to 18 °C and 28 °C to 50 °C
Time	1 year
Qualifiers	
Warm-up time	Specs are valid after 1 hour warm-up
Operating temperature	23 ± 5 °C
RH	80 % RH from 0 to 35 °C, 70 % to 50 °C
Storage temperature	40 °C to 60 °C
Vibration	Meets requirements of MIL-T-28800E for Type III, Class 3, Style E equipment
EMI susceptibility	Complies with EN 50082-1
Altitude	2000 meters
Power line regulation	100 V/ 120 V/ 220 V/ 240 V ± 10 %
Overvoltage protection	600 V overvoltage category III

Table 1: Key elements of the DMM specification.

Baseline uncertainty specifications

Baseline specifications are usually given as:

± (percent of reading + number of digits)

or

 \pm (percent of reading + number of counts)

"Digits" or "counts" are used interchangeably and they indicate the value of the least significant digits for a particular range. They represent the resolution of the DMM for that range. If the range is 40.0000 then one digit, one count, is worth 0.0001.

Let's say you want to measure 10 V on a 20 V range in which the least significant digit represents 0.0001 V. If the uncertainty for the 20 V range is given as \pm (0.003 % + 2 counts) we can calculate the uncertainty in measurement units as:

 \pm ((0.003 % x 10 V + 2 x 0.0001 V) = \pm (0.0003 V + 0.0002 V) = \pm (0.0005 V) or \pm 0.5 mV

Some spec sheets use the form: ± (percent of reading + percent of range)

Top three pitfalls of using DMM specs

- 1. Using only the percent of reading as a shortcut
- 2. Applying specs to DMM's that fall outside of their calibration cycle
- 3. Using a DMM outside its temperature range without de-rating uncertainties



In this case you simply multiply the maximum reading for the range by a percentage to get the second term. In both cases the second term is called "the floor". The floor considers the effects of offsets and noise associated with a single range as well as those common to all ranges. Ignoring this term can have significant consequences, especially for measurements near the bottom of a range.

Uncertainty modifiers

Modifiers can be applied to the uncertainty specs to account for common environmental or time factors. Some specifications will give not only one-year specs, but also specs that apply for, say, 90 days after calibration. The 90-day spec will be tighter than the 1-year spec. This allows a DMM to be used in more demanding applications by calibrating more frequently.

For reasons already covered, uncertainty specs are valid over a specified temperature range. Commonly the range encompasses "room temperature", from 18 °C to 28 °C (64.4 °F to 82.4 °F) when calibrated at 23 °C. Over a wider range the uncertainty can be modified to account for the temperature.

Say you need to take the same 10 V measurement performed above, at a field location where the temperature is 41 °C (106 °F). The temperature coefficient of your DMM is given as:

± (0.001 % of reading) per °C from 0 °C to 18 °C and 28 °C to 50 °C

The temperature is 13 °C above the 28 °C boundary for using unmodified baseline uncertainty. For each degree above the boundary, we have to add $0.001 \% \times 10 V = 0.1 \text{ mV/°C to}$ the baseline uncertainty. The added uncertainty at 41 °C is $13 \,^{\circ}\text{C} \times 0.1 \,\text{mV/}^{\circ}\text{C} = 1.3 \,\text{mV}. \,\text{So}$ the total voltage uncertainty, combining the baseline uncertainty calculated in the example above and the temperature modifier would be \pm (0.5 mV + 1.3 mV) = ± 1.8 mV. Notice that the

modified uncertainty is more than three times larger than the baseline!

Oualifier specifications

DMM uncertainties depend on other conditions besides time and temperature. Environmental factors such as storage temperature, humidity, air density, and electromagnetic radiation can affect uncertainty. The DMM must receive reasonably clean power if its precision internal power supplies are to function properly.

Some qualifiers can be easily specified by numerical values, like power line regulation, altitude and relative humidity. DMMs are not hermetically sealed, so air becomes a component of their circuitry. The electrical characteristics of air are affected by density (altitude) and humidity, so designers set boundaries on these parameters. Excessive storage temperatures can irreversibly alter the operating characteristics of electronic components.

More complex qualifiers like overvoltage protection, shock and vibration, or electromagnetic compatibility are given by noting compliance with standard measurement techniques and limits. International standards documents for these characteristics typically require a series of test procedures along with applicable limits. Adding all of the limits would render the DMM specifications too cumbersome, so DMM designers just list the standards with which the DMM complies.

Comparing different digital multimeters

When you are evaluating the suitability of several digital multimeters, the best approach is to choose a set of measurements and conditions that approximate your application. First, make sure the qualifiers of each DMM are compatible with the application environment. Then consider all of the functions (dc volts, ac volts, dc amps, ohms and so forth) and ranges you are likely to use. Are you going to be making a lot of measurements near the bottoms of ranges? Then make sure you compare with low readings to check the contribution of the floor. For each measurement, convert the uncertainty into measurement units like volts, ohms or amps. Compare the uncertainties in measurement units to decide which DMM is better suited to the task at hand.

The ability to work with DMM uncertainty specifications is a fundamental engineering skill. When you get two different answers from two different DMMs, measurement uncertainty might explain the difference. When you need to compare the performance of DMMs to decide the right tool for the job, being proficient with uncertainty specs will help you compare apples to apples. And whenever you are depending on an important measurement, you can be comfortable understanding how well your instrument will really perform.

Fluke Calibration. Precision, performance, confidence.™

Electrical RF Temperature Flow Software Pressure

Fluke Calibration PO Box 9090 Everett, WA 98206 U.S.A. Fluke Europe B.V. PO Box 1186, 5602 BD Eindhoven, The Netherlands

For more information call:

In the U.S.A. (877) 355-3225 or Fax (425) 446-5116 In Europe/M-East/Africa +31 (0) 40 2675 200 or Fax +31 (0) 40 2675 222 In Canada (800)-36-FLUKE or Fax (905) 890-6866 From other countries +1 (425) 446-5500 or Fax +1 (425) 446-5116 Web access: http://www.fluke.com

@2006-2011 Fluke Corporation. Specifications subject to change without notice. Printed in U.S.A. $1/2011\ 2547797B\ A$ -EN-N Pub_ID: 11066-eng Rev 02

Modification of this document is not permitted without written permission from Fluke Corporation.